

VEVOR

Affordable. Reliable. Home Improvement.

**AUTOMOTIVE TAIL
LIGHT ASSEMBLIES
MODEL: 03SDBTBK/03SDBTRD**

VEVOR

Affordable. Reliable. Home Improvement.

AUTOMOTIVE TAIL LIGHT ASSEMBLIES

MODEL: 03SDBTBK/03SDBTRD



<Picture Only For Reference >

This is the original instruction, please read all manual instructions carefully before operating. VEVOR reserves a clear interpretation of our user manual. The appearance of the product shall be subject to the product you received. Please forgive us that we won't inform you again if there are any technology or software updates on our product.

IMPORTANT SAFEGUARDS



WARNING: Read and understand this entire manual before operating or servicing this product. Failure to follow these warnings and instructions can cause personal injury or damage to valuable property.

- Avoid children using the product. And this product is not a toy. Do not allow children to play.
- It is highly recommended that you go to a professional car modification service shop for replacement installation.

ASSEMBLY PRECAUTIONS

1. Assemble only according to these instructions. Improper assembly can create hazards.
2. Wear ANSI-approved safety goggles and heavy-duty work gloves during assembly and use.
3. Keep the assembly area clean and well-lit.
4. Keep bystanders out of the area during assembly.
5. Do not assemble when tired or when under the influence of alcohol, drugs or medication.
6. Product capabilities apply to properly and completely assembled products only.
7. For additional information regarding the parts listed in the following pages, please refer to the Assembly Diagram of this manual. Unwrap and separate all parts in a clean work area. Please keep small spare parts out of children's reach.

SAVE THESE INSTRUCTIONS

PROBLEM POINTS AND SOLUTIONS

COMMON CAUSES OF TAILLIGHT CONDENSATION	Solution
Large changes in daily temperature	Check that all vents are free from blockages. Turn on the lights for 20mins to raise the taillight temperature and evaporate condensation.
Leaking seals on bulbs and/or bulb sockets	Remove bulbs to allow moisture to evaporate from inside the housing. Heat with a hairdryer to speed up the process.
Taillight turned on and the bulbs heated up inside the housing the hot air will turn into moisture.	Leaking seals on bulb sockets. Put moisture absorbing silica-gel desiccant packet inside the taillight.

SPECIFICATION

Model	03SDBTBK	03SDBTRD
Material	PC+PMMA	
Rating for light	DC12V	
Position	RH/LH	
Color	Black	Red
Light source	LED	LED
Suitable vehicle	2003-2006 Chevrolet Silverado 1500 1500 HD, 2003-2006 Chevrolet Silverado 2500 2500 HD, 2004-2006 Chevrolet Silverado 3500 , 2007-2007 Chevy Classic [2-Door Regular Cab 4-Door Extra Cab 4-Door Crew Cab]	

PACKAGE LIST

① Tail Light Assemblies*2, ② Manual *1

Cautions:

If you purchase the models "03SDBTBK" and "03SDBTRD", please note that you should keep the original rear reversing lamp of the vehicle and install them on the new light assembly for use. The rear reversing lamps are not included in these product's models.

If you purchase the models "99SDBK" and "02SSBK", please note that you should keep the original lamp of the vehicle and install them on the new light assembly for use. The lamps are not included in these product's models.

Replacement

※ Please check the maintenance manual of the vehicle;

HINT:

The Install procedure for the RH side is the same as that for the LH side.

STEP1: Remove existing tail light

1. Open the tailgate ,remove 2 mounting screws.



2. Remove the original factory taillight assembly, and all taillight sockets and bulbs (Note: The original reversing lights need to be retained and installed on the new lights).




3.Remove all the light bulbs except the original reversing light bulb of the car.



STEP2: Install the new taillight.

1.Connect the harness terminal of the new light to the terminal block of the car(except for the original reverse bulb).Then screw the harness terminal base into the lamp house.

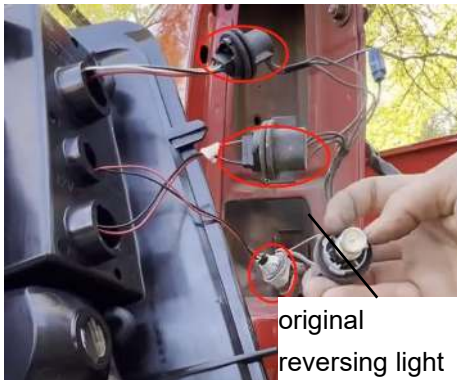

original
reversing light



2.Locate taillight assembly,Connect taillight harness,Seat taillight assembly in place.Test our light make sure everything works as it should.



3.Reinstall 2 mounting screws.



※The above figure shows the replacement of only one of the models, the operation process is similar for other models.

Complete the replacement.



Sanven Technology Ltd.

Address: Suite 250, 9166 Anaheim Place, Rancho Cucamonga, CA 91730

